SIEMENS EDA

ODB++ Inside for Cadence® Allegro® Release Notes

Software Version 2510 October 2025



Unpublished work. © 2025 Siemens

This Documentation contains trade secrets or otherwise confidential information owned by Siemens Industry Software Inc. or its affiliates (collectively, "Siemens"), or its licensors. Access to and use of this Documentation is strictly limited as set forth in Customer's applicable agreement(s) with Siemens. This Documentation may not be copied, distributed, or otherwise disclosed by Customer without the express written permission of Siemens, and may not be used in any way not expressly authorized by Siemens.

This Documentation is for information and instruction purposes. Siemens reserves the right to make changes in specifications and other information contained in this Documentation without prior notice, and the reader should, in all cases, consult Siemens to determine whether any changes have been made.

No representation or other affirmation of fact contained in this publication shall be deemed to be a warranty or give rise to any liability of Siemens whatsoever.

If you have a signed license agreement with Siemens for the product with which this Documentation will be used, your use of this Documentation is subject to the scope of license and the software protection and security provisions of that agreement. If you do not have such a signed license agreement, your use is subject to the Siemens Universal Customer Agreement, which may be viewed at https://www.sw.siemens.com/en-US/sw-terms/base/uca/, as supplemented by the product specific terms which may be viewed at https://www.sw.siemens.com/en-US/sw-terms/supplements/.

SIEMENS MAKES NO WARRANTY OF ANY KIND WITH REGARD TO THIS DOCUMENTATION INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, AND NON-INFRINGEMENT OF INTELLECTUAL PROPERTY. SIEMENS SHALL NOT BE LIABLE FOR ANY DIRECT, INDIRECT, INCIDENTAL, CONSEQUENTIAL OR PUNITIVE DAMAGES, LOST DATA OR PROFITS, EVEN IF SUCH DAMAGES WERE FORESEEABLE, ARISING OUT OF OR RELATED TO THIS DOCUMENTATION OR THE INFORMATION CONTAINED IN IT, EVEN IF SIEMENS HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

TRADEMARKS: The trademarks, logos, and service marks (collectively, "Marks") used herein are the property of Siemens or other parties. No one is permitted to use these Marks without the prior written consent of Siemens or the owner of the Marks, as applicable. The use herein of third party Marks is not an attempt to indicate Siemens as a source of a product, but is intended to indicate a product from, or associated with, a particular third party. A list of Siemens' Marks may be viewed at: https://www.sw.siemens.com/en-US/trademarks/. The registered trademark Linux® is used pursuant to a sublicense from LMI, the exclusive licensee of Linus Torvalds, owner of the mark on a world-wide basis.

About Siemens Digital Industries Software

Siemens Digital Industries Software is a global leader in the growing field of product lifecycle management (PLM), manufacturing operations management (MOM), and electronic design automation (EDA) software, hardware, and services. Siemens works with more than 100,000 customers, leading the digitalization of their planning and manufacturing processes. At Siemens Digital Industries Software, we blur the boundaries between industry domains by integrating the virtual and physical, hardware and software, design and manufacturing worlds. With the rapid pace of innovation, digitalization is no longer tomorrow's idea. We take what the future promises tomorrow and make it real for our customers today. Where today meets tomorrow. Our culture encourages creativity, welcomes fresh thinking and focuses on growth, so our people, our business, and our customers can achieve their full potential.

Support Center: https://support.sw.siemens.com

Send Feedback on Documentation: https://support.sw.siemens.com/doc_feedback_form

Table of Contents

ODB++ Inside Release Notes	1
Enhancements in ODB++ Inside 2510	2
Enhancements in Earlier Versions	2
Problems Fixed in ODB++ Inside 2510	3
Problems Fixed in Earlier Versions	4
Known Problems and Workarounds	9
Support Information	

ODB++ Inside Release Notes

This document provides a high-level summary of the corrected defects and enhancements in the ODB++ Inside 2510 release.

Release documents are located on the Downloads page of the ODB++Design website—refer to this page for the most up-to-date information, including the changes added after the release:

https://odbplusplus.com/design/downloads/odb-d-inside

Before you install the software, be aware of the following:

- ODB++ Inside migrated to the Qt6 framework in version 2504. On Linux systems, the following additional libraries are required for the software to run correctly:
 - libnsl.so.2 (provided via a symbolic link to libnsl.so)

```
sudo ln -s /usr/lib64/libnsl.so /usr/lib64/libnsl.so.2
```

libxcb-cursor0 (version 0.1.3-150400.3.2.3)

```
sudo rpm -i libxcb-cursor0-0.1.3-150400.3.2.3.x86_64.rpm
```

For a complete list of dependencies for each supported platform, refer to Supported Operating Systems for ODB++ Inside the ODB++ Inside System Requirements document.

- Starting with the 2504 release, the default path for new installations is C:\SiemensEDA. When upgrading from ODB++ Inside version 2409, the software retains the existing directory, typically C:\MentorGraphics. However, if you upgrade from a version earlier than 2409 and select the default path for the VALOR_DIR directory, you must copy the contents of your previous VALOR_DIR directory to the new location to retain access to your system data. See Migrating VALOR_DIR Data During a Software Upgrade in ODB++ Inside Installation Guide.
- The ODB++ Inside Documentation InfoHub has been deprecated. Product documentation remains included with the installation, and you can access it by pressing F1 from the active window. The HTML toolbar contains controls with tooltips displaying the titles of relevant topics or books:
 - The Table of Contents button provides a link to the parent section, up to the *docs* directory that lists all the installed books.
 - The navigation arrows enable moving to the next or previous topic within the current book.

Enhancements in ODB++ Inside 2510	2
Enhancements in Earlier Versions	2
Problems Fixed in ODB++ Inside 2510	3
Problems Fixed in Earlier Versions	4
Known Problems and Workarounds	9
Support Information	

Enhancements in ODB++ Inside 2510

This version adds improved functionality.

- EBS-164674 Add support for export of "Advanced Degassing" patterns.
 - Implemented. The following degassing shapes are now handled correctly: CIRCLE, HEXAGON_X, HEXAGON_Y, OBLONG_Y, OCTAGON, RECTANGLE, SQUARE.
- EBS-167795 Make the Select action default in the graphic area.
 - Implemented. The default action on window opening has been changed from Zoom Area to Select.
- EBS-167796 Replicate the behavior of the middle mouse button to Esc (keyboard).
 - Implemented. The Esc key now cancels or reverses actions in the graphic area.

Enhancements in Earlier Versions

This section lists new features and improvements introduced ODB++ Inside since version 2211.

Enhancements in ODB++ Inside 2504

- EBS-157341 Improve the representation of Electrical Type and Mount Type information across the User Interface.
 - The display has been unified in the entire application to present the Electrical Type as B, E, M, or U, and the Mount Type as SMT (or S), SMT PR (or D), TH (or T), TH_RH (or R), PRESS_FIT (or P), NON_BOARD (or N), HOLE (or H), or Unknown (or U).
- EBS-157489 Translate the solder mask thickness from Cadence and place it in the Dielectric Thickness attribute.
 - Layers of type soldermask are assigned the Dielectric Thickness attribute with the value specified in the layers file.
- EBS-158606 Improve the Cadence translation to set .is buried component attribute correctly.
 - The .is_burried attribute is now assigned to components only if they are located on an inner layer inside a rigid area of the board.

Enhancements in ODB++ Inside 2409

• EBS-157488 — Store Cadence "class:subclass" in the new attribute .class_source.

The method for storing the EDA origin of graphic elements has been improved, with class and subclass information contained in a new feature attribute .class_source.

Enhancements in ODB++ Inside 2403

• EBS-150417 — Assign Backdrill attributes during Allegro translation.

Valor NPI now reads the maximum backdrill depth, maximum PTH stub length, and Must Not Cut layer information from Allegro-generated .out files and adds the associated attributes in the design.

Enhancements in ODB++ Inside 2305

• EBS-142972 — Arc is inconsistent between Profile and Outline layer.

Differences between the rout layer and the documentation layer containing the rout data were caused by too much tolerance used to create the step profile. This is now fixed.

• EBS-142003 — Zone data is solid fill and does not include names of zones.

In addition to the mask layers flex_area and rigid_area, which contain solid fill shapes representing the zones, the translation creates a document layer called zone_outline to store the zone data in the form of lines, arcs, and text.

• EBS-143527 — "Rout" layer conflicts with "Profile" for Allegro based on geometry file.

A rout layer named "profile" is created from the "OUTLINE" or "DESIGN_OUTLINE" field in the .geoms file if the "Create Rout From Artwork Layer" parameter is not set or contains the name of a non-existing layer.

- EBS-143294 Environment variable BRD2ODB_TMP has been made obsolete and replaced by VALOR TMP.
- **EBS-138952** Switch -kal has been added for setting the configuration parameter "Keep auxiliary layers name as in artwork" to Yes.
- EBS-142002 Translation algorithm has been improved to correctly determine the placement of test points based on SYM MIRROR data..
- EBS-142254 The rout layer type creation logic has been fixed to use BOARD GEOMETRY:DESIGN_OUTLINE instead of BOARD GEOMETRY:OUTLINE when data exists in both of these subclasses and "Create Route From Artwork Layer" is not set with the name of a valid layer..

Enhancements in ODB++ Inside 2211

• EBS-135095 — The ODB++Design Inside installer creates a file named *env_file*, containing variable settings that reflect values specified during installation. The environment variable VALOR_DIR, located in this file, points to the system directory VALOR_DIR in which configuration and work files requiring writing permissions are stored.

Problems Fixed in ODB++ Inside 2510

This version addresses several issues reported by customers or identified internally.

• **EBS-162346** — Rout is not created from the specified artwork layer when "Component Outline" is set to "DFA".

Resolution: When the "Component Outline" parameter was set to "DFA", the "Create Rout From Artwork Layer" parameter was incorrectly overridden to "DFA BOUND ROUT". This is now fixed.

• EBS-163335 — Incorrect splash screen displays when invoking ODB++ Viewer from Cadence Allegro.

Resolution: Fixed.

• EBS-164137 — Translation results in incorrect rotation of non-circular holes (slots).

Resolution: Fixed.

• EBS-164544 — Outer pads for specific drill spans are removed even if the additional parameter "Don't suppress pads on top/bottom" is set to "yes".

Resolution: The "Don't suppress pads on top/bottom" parameter is no longer available for editing. The top and bottom pads on drill holes are always preserved, even if the "Suppress Unconnected Pads" option is selected.

• EBS-164775 — Zone data is incorrectly mapped to rigid and flex areas..

Resolution: Rigid areas are now created for regions with no zone data defined. If no flex regions are defined in the zones file, zones in which all layers have the "_flex" subtype are used to define flex areas.

• EBS-167083 — Failure to read data stored on a UNC path.

Resolution: Fixed. Double slashes and other special characters in file paths are now processed correctly.

• EBS-167156 — The .is_buried (Embedded Passive) component attribute is not imported from Cadence Allegro or OrCAD Layout in version 2504.

Resolution: The attribute was not set for components in incorrectly mapped flex regions. Zone data is now processed correctly, and the issue no longer occurs.

• EBS-168695 — ODB++ assembly export fails for designs with embedded net short parts.

Resolution: Fixed.

Problems Fixed in Earlier Versions

This section lists defects fixed in ODB++ Inside since version 2211.

Problems Fixed in ODB++ Inside 2504

• EBS-153532 — Translation results in toeprints missing net connections in VAL/CAD format.

Resolution: Fixed.

• EBS-155468 — Incorrect shape-to-shape spacing in translation Cadence out files into ODB++ product model.

Resolution: The discrepancy was caused by endpoint shifts during the SIP removal process. The continuity of segments and curves has been restored.

• EBS-155930 — Pad not connected to the net after translation of CAD format file.

Resolution: Fixed.

• EBS-155931 — Component height attribute is not set during translation.

Resolution: The "COMP_HEIGHT" field has been added to the comps_<pm>.out file. If the value in this field includes units, it is used to set the ODB++ attribute .comp_height.

• EBS-156809 — Translation results in incorrectly rotated component pins.

Resolution: Fixed.

• EBS-158112 — Failure to create layers according to a Matrix File.

Resolution: Fixed. The translation algorithm has been updated not to create dielectric layers when a Matrix File path is specified.

• EBS-158491 — Rout layer is always converted into 10 mil.

Resolution: Fixed. The width of rout features is now taken from the Cadence data unless the value is zero, in which case the value of configuration parameter edt rout display width is used.

• EBS-158994 — Failure to translate net short data involving a net name "NONE" and non-numbering pin names.

Resolution: Fixed.

• EBS-159491 — False alarms for drill-to-copper shorts in Pin Point mode.

Resolution: Fixed by adding a logic to prevent hole duplication.

• EBS-159995 — The component outline for some mounting holes on the bottom layer is lost in Valor NPI.

Resolution: Fixed. For components with geometry on both sides of the board, one side is chosen based on the established logic. The shape of this side, determined by the SYM_MIRROR, PLACEMENT_LAYER, and EMBEDDED STATUS data, is used to create the outline.

• EBS-160049 — Large arc rendered into segments.

Resolution: The documentation has been updated to state that features extending beyond the coordinate ranges of (-100, -100) to (100, 100) inches or (-2540, -2540) to (2540, 2540) millimeters may be fragmented during translation.

• EBS-161328 — The "eda_flex_material" parameter value is overridden by an empty value when translating directly from Cadence with the "Define Flex material list" parameter left empty.

Resolution: Fixed. If "Define Flex material list" is empty, the translator uses the value already set in the configuration parameter "eda flex material".

• EBS-161528 — Pad suppression produces inconsistent results.

Resolution: The translation algorithm has been fixed to prevent the suppression of pads that are crossed by traces reaching the center of the associated drill.

• EBS-162329 — Netlist check report showing inconsistent results.

Resolution: The issue was caused by incorrect translation of zones defined as NONCONNECTED geometry in the geoms file. This is now fixed.

• EBS-162390 — Profile is not translated in Valor NPI versions 2305 and 2409.

Resolution: Fixed.

• EBS-162491 — Copper Thickness field displays extra decimal places for values in metric units.

Resolution: Fixed.

• EBS-162595 — Intentional short traces are missing in a specific design after translation.

Resolution: Fixed.

• EBS-162626 — The color of layers with type "power_ground" and subtype "pg_flex" is incorrect in the Matrix.

Resolution: Fixed.

• EBS-162678 — Wrong component shape is generated for components placed on inner layers when translating with PLACE_BOUND outline.

Resolution: Fixed.

• EBS-164114 — Translation fails for designs with more than 200 layers when the pad suppression option is selected.

Resolution: Fixed by increasing the layer limit from 200 to 1024.

Problems Fixed in ODB++ Inside 2409

• EBS-145444 — Incorrect application name and version number in the SAVE_APP field of the product_model_name/misc/info file.

Resolution: Fixed.

• EBS-147209 — Exported ODB++ file name inconsistent with the BRD file name.

Resolution: Fixed by adding support for importing BRD files with capital letters in the name.

• EBS-154412 — Rout layer does not match the Profile from Allegro translation.

Resolution: The issue occurred due to mishandling of BOARD GEOMETRY:CUTOUT data when creating an ODB++ rout layer. This is now fixed.

• EBS-157677 — Component spacing ranges are not imported correctly from DFA files generated by Cadence Allegro versions later than 17.4..

Resolution: Fixed.

Problems Fixed in ODB++ Inside 2403

• EBS-150573 — Unconnected pads not suppressed in Cadence translation.

Resolution: The Cadence method for isolated pad recognition has been updated to ignore pads that are crossed off-center by a trace intersecting the centers of the corresponding drill and pin.

• EBS-150671 — ODB++ Inside does not create top/bottom layers when layer names are L1_SURFACE and L8_BASE.

Resolution: Configuration parameters eda_cadence_apd_bot_name and eda_cadence_apd_top_name now support wildcard characters (*) in the names of the bottom and top layers in APD out files, for example, "*SURFACE" and "*BASE".

Problems Fixed in ODB++ Inside 2311

• EBS-143429 — brd2odb.exe errors with large design.

Resolution: Translator crashed when the input path contained a BRD file larger than 2 GB, due to a limitation in the system function checking the file size. This is now fixed.

• EBS-146525 — Cadence FAB file not detected.

Resolution: Support for import of Cadence FAB files has been added.

• EBS-146788 — ODB++ Inside installer incorrectly edits env file.

Resolution: Updating an existing ODB++ Inside installation caused some environment variables commented out in the env file file to become active. This is now fixed.

• EBS-148632 — PDF of an earlier version's user guide found in the ODB++ Inside installation directory.

Resolution: Fixed. Redundant documentation has been removed.

• EBS-148777 — Cadence translation fails on specific data.

Resolution: Fixed by adding PANEL_OUTLINE as an option for the additional parameter Panel Outline as Profile = no.

• EBS-149079 — The body shown as large however it should be small.

Resolution: The display of double-sided components has been fixed to show only the geometry associated with the PLACEMENT_LAYER.

Problems Fixed in ODB++ Inside 2305

• EBS-142972 — Arc is inconsistent between Profile and Outline layer.

Resolution: Differences between the rout layer and the documentation layer containing the rout data were caused by too much tolerance used to create the step profile. This is now fixed.

• EBS-142003 — Zone data is solid fill and does not include names of zones.

Resolution: In addition to the mask layers flex_area and rigid_area, which contain solid fill shapes representing the zones, the translation creates a document layer called zone_outline to store the zone data in the form of lines, arcs, and text.

• EBS-143527 — "Rout" layer conflicts with "Profile" for Allegro based on geometry file.

Resolution: A rout layer named "profile" is created from the "OUTLINE" or "DESIGN_OUTLINE" field in the .geoms file if the "Create Rout From Artwork Layer" parameter is not set or contains the name of a non-existing layer.

• EBS-144183 — Fix urgently some issues with the ODB++ Inside for Cadence installer.

Resolution: Installer sets VALOR_HOME & VALOR_TMP with the paths \$VALOR_DIR and \$VALOR_DIR/tmp, respectively. Additional content from previous env_file is copied to the new env_file during installation. config file is now installed under \$VALOR_DIR/sys.

• EBS-144187 — Installer of ODB++ Inside Cadence Allegro should be consistent between Windows and Linux.

Resolution: The location of the documentation tree on Linux has been changed from ../ brd2odb <ver>/all/docs to ../brd2odb <ver>/all/manuals/docs.

• EBS-138884 — Special symbol from Allegro to ODB++ are in different size.

• EBS-142072 — Short caused by Top Side Comp J5500.

Problems Fixed in ODB++ Inside 2211

- EBS-110665 Incorrect netpoint location for feature translated from Cadence.
- EBS-135095 BRD2ODB Fails when installed on a server.
- EBS-136524 ODB++ inside export negative feature incorrectly.
- EBS-137857 Incorrect profile created from a single circle feature.
- EBS-138806 ODB2BRD Returns Undefined Symbol error on Linux.
- EBS-139605 Problem with Silkscreen figure appearing on wrong layer.
- EBS-139611 Step does not get created by EDA Translation (not saved after translation).
- EBS-140859 Use Panel Outline as Profile in Allegro Interface.

Known Problems and Workarounds

We are aware of the following issues in this release.

- Advanced degassing holes are not rotated in ODB++Design.
 - The *geoms_<pm>.out* file does not support rotation for advanced degassing holes, resulting in vertical orientation upon translation.
- Cursor distortion in Extend mode on Windows.

Description: Different scale settings between screens may cause the mouse cursor to change shape unexpectedly. This occurs because each screen generates a cursor based on its own scale. For example, clicking a measuring tool and then moving the window to another screen, may change the cursor into a right arrow.

Workaround: Repeat the action associated with the cursor to refresh the cursor appearance on the new screen.

Support Information

You can use a streamlined process to report a problem, receive guidance on the ODB++ Inside installation, or receive help with a task you are trying to accomplish while using the tool.

To submit a support case, complete the form on the Contact page of the ODB++Design website:

https://odbplusplus.com/design/contact